



## DS5001FP 128k Soft Microprocessor Chip

[www.maxim-ic.com](http://www.maxim-ic.com)

### REVISION B4 ERRATA

The errata listed below describe situations where DS5001FP revision B4 components perform differently than expected or differently than described in the data sheet. Dallas Semiconductor intends to fix these errata in subsequent die revisions.

This errata sheet only applies to DS5001FP revision B4 components. Revision B4 components are branded on the topside of the package with a six-digit code of the form yywwB4, where yy and ww are two-digit numbers representing the year and work-week of manufacture, respectively. To obtain an errata sheet on another DS5001FP die revision, visit the website at [www.maxim-ic.com](http://www.maxim-ic.com).

#### 1. STATE OF CARRY BIT CAN CAUSE HIGH STOP MODE CURRENT

**Description:**

Selection of Stop mode with the carry bit set will cause the  $I_{STOP}$  parameter to be as high as 450 $\mu$ A.

**Work Around:**

Clear the carry bit before selecting Stop mode.