

# MAX32660

## ERRATA SHEET

### Revision A2 Errata

The errata listed below describe situations where components of this revision perform differently than expected or differently than described in the data sheet. Maxim Integrated Products, Inc. may, at its own discretion, take future steps to correct these errata when the opportunity to redesign the product presents itself. Prior to that, Maxim has determined the following potential workarounds that customers may want to consider when addressing one of the situations described below.

This errata sheet only applies to components of this revision. These components are branded on the topside of the package with a six-digit code in the form yywwRR, where yy and ww are two-digit numbers representing the year and work week of manufacture, respectively, and RR is the revision of the component. To obtain an errata sheet on other die revisions, visit our website at [www.maximintegrated.com/errata](http://www.maximintegrated.com/errata).

#### 1) I2S IN SLAVE MODE CAN RECORD INCORRECT DATA IF A PARTIAL WORD IS RECEIVED DURING LEFT CHANNEL RECEPTION

**Description:**

While in slave mode, receipt of a partial/truncated word in the left data channel loads incorrect data into the I2S RX\_FIFO.

**Workaround:**

- 1) Do not enable the I2S peripheral while the I2S master is transmitting.
- 2) Ensure that the I2S master begins all transmissions with a complete word.

#### 2) I2S DOES NOT OPERATE AS EXPECTED IF SPIMSSn\_DMA.tx\_fifo\_lvl IS SET TO 0b000

**Description:**

Transmit data can be corrupted if the I2S transmit FIFO is allowed to empty during a transaction.

**Workaround:**

The workaround for this erratum is incorporated in the relevant Maxim-supplied API. No user action is required when using the Maxim-supplied API.

In the case the user wants to implement their own API, the workaround is to set the SPIMSSn\_DMA.tx\_fifo\_lvl to a value other than 0b000.

#### 3) I2S PAUSE BIT MUST REMAIN SET A MINIMUM OF TWO LRCLK PERIODS

**Description:**

Software writes to the SPIMSSn\_I2S\_CTRL.i2s\_pause bit require at least two LRCLK periods to be recognized.

**Workaround:**

Ensure software delays a minimum of two LRCLK periods between changes to SPIMSSn\_I2S\_CTRL.i2s\_pause.



#### 4) SPI MASTER DOES NOT OPERATE AS EXPECTED IF SPI TX\_FIFO EMPTY FLAG IS USED

**Description:**

Transmit data can be corrupted if the TX\_FIFO is allowed to empty during a transaction.

**Workaround:**

The workaround for this erratum is incorporated in the relevant Maxim-supplied API. No user action is required when using the Maxim-supplied API.

In the case the user wants to implement their own API, the workaround is to use the programmable TX\_FIFO threshold interrupt instead of the TX\_FIFO empty interrupt.

#### 5) DISABLING THE I<sup>2</sup>C PERIPHERAL DURING A TRANSACTION ERRONEOUSLY SETS THE STOPI BIT

**Description:**

Disabling the I<sup>2</sup>C peripheral during a transaction erroneously sets I2Cn\_INTFL0.stopi.

**Workaround:**

The workaround for this erratum is incorporated in the relevant Maxim-supplied API. No user action is required when using the Maxim-supplied API.

In the case the user wants to implement their own API, the I2Cn\_INTFL0.stopi should always be cleared before enabling the I<sup>2</sup>C peripheral.

#### 6) UART TX\_FIFO DOES NOT GENERATE AN INTERRUPT IF EMPTY

**Description:**

UARTn\_CTRL1.tx\_fifo\_lvlo = 0 does not cause an interrupt when the TX\_FIFO becomes empty (ME11-162).

**Workaround:**

Set UARTn\_CTRL1.tx\_fifo\_lvlo > 0 to cause an interrupt before the TX\_FIFO becomes empty.

#### 7) QSPI IN SLAVE MODE DOES NOT OPERATE CORRECTLY, SCK FALL TIME IS SLOW

**Description:**

SSEL must transition after SCK is already low. This is only an issue in designs with slow falling transitions on SCK (ME11-164).

**Workaround:**

Ensure the SPI master has sufficient drive capability to pull SCK low before SSEL goes low.

#### 8) UART FIELD UARTn\_BAUD1.dbaud MUST BE SET ±3 BITS

**Description:**

The UART baud rate setting for the IC must differ slightly from the target baud rate (ME11-155).

**Workaround:**

When calculating the value of UARTn\_BAUD1.dbaud, add or subtract 3 bits from the value determined by the formula in the User Guide. The small offset required by this erratum is within the baud rate tolerances of most UART communications.

#### 9) RTSS[31:28] WILL ALWAYS BE 0000b WHEN READ BY SOFTWARE

**Description:**

Software reads of the RTSS register will always return RTSS[31:28] = 0000b. This only affects software reads, and software writes to those bits correctly. Hardware updates the full 32-bit counter correctly and the RTC alarm functions operate correctly. (ME11-161)

**Workaround:**

None. Disregard RTSS[31:28] when reading the RTSS register.

## Revision History

REVISION NUMBER	REVISION DATE	DESCRIPTION	PAGES CHANGED
0	3/19	Initial release	—

© 2019 Maxim Integrated Products, Inc. All rights reserved. The Maxim logo and Maxim Integrated are trademarks of Maxim Integrated Products, Inc. in the United States and other jurisdictions throughout the world.